

© Jaguar Land Rover North America, LLC

NOTE: The information in Technical Bulletins is intended for use by trained, professional Technicians with the knowledge, tools, and equipment required to do the job properly and safely. It informs these Technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by 'do-it-yourselfers'. If you are not a Retailer, do not assume that a condition described affects your vehicle. Contact an authorized Jaguar service facility to determine whether this bulletin applies to a specific vehicle.

**This reissue replaces all previous versions. Please destroy all previous versions.**

Changes are highlighted in gray

**SECTION: 310-01**

**Fuel Tank Difficult to Fill**

**AFFECTED VEHICLE RANGE:**

**F-TYPE (X152)**

**Model Year:** 2014-2016  
**VIN:** K00001-K32543  
**Manufacturing Plant:** Castle Bromwich

**MARKETS:**

NAS

**CONDITION SUMMARY:**

**Situation:** The fuel tank may be difficult to fill, with the fuel delivery 'cutting out' several times.  
**Cause:** This may be caused by an insufficient flow rate of the fuel tank filler pipe.  
**Action:** Should a customer express this concern, follow the Service Instruction below.

**PARTS:**

|          |                                     |             |
|----------|-------------------------------------|-------------|
| T2R21271 | Fuel tank filler pipe - Convertible | Quantity: 1 |
| T2R21272 | Fuel tank filler pipe - Coupe       | Quantity: 1 |
| C2D38206 | Fuel tank filler pipe cap           | Quantity: 1 |
| T2R21273 | Protection shield                   | Quantity: 1 |

**TOOLS:**

Refer to Workshop Manual for any required special tools.

**WARRANTY:**

 **NOTE: Repair procedures are under constant review, and therefore times are subject to change; those quoted here must be taken as guidance only. Always refer to TOPIx to obtain the latest repair time.**

 **NOTE: DDW requires the use of causal part numbers. Labor only claims must show the causal part number with a quantity of zero.**

| DESCRIPTION                                 | SRO                | TIME (HOURS) | CONDITION CODE | CAUSAL PART |
|---|--------------------|--------------|----------------|-------------|
| Fuel tank filler pipe - Renew - Convertible | <b>19.55.33.70</b> | 2.1          | 16             | T2R13692    |
| Fuel tank filler pipe - Renew - Coupe       | <b>19.55.33</b>    | 2.5          | 16             | T2R13692    |

 **NOTE: Normal Warranty procedures apply.**

**SERVICE INFORMATION:**

| Engine Variant           | LEVIII Fuel Cap Required? |
|--------------------------|---------------------------|
| 3.0L SC V6 - 2014-2015MY | Yes                       |
| 3.0L SC V6 - 2016MY      | No                        |
| 5.0L SC V8 - 2014-2016MY | Yes                       |

**SERVICE INSTRUCTION:**

- 1Renew the fuel tank filler pipe (see TOPIx Workshop Manual, section 310-01).
- 2Install the modified fuel tank filler pipe protection shield.

**3Only if required:** refer to service information. If required, install a new fuel tank filler pipe cap.