

COLOUR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN / OUT	TAG	
	16	JAGUAR F-Type	SAJXB6FC1G8K27692		24139/24139	T7692	
DEL. DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
28SEP15 IS							
16FEB19 DD	16JUN15		17:30 26FEB19		0.00	CASH	05MAR19

R.O. OPENED: 13:45 26FEB19 READY: 13:09 05MAR19
 OPTIONS: SOLD-STK:P1683 DLR:RO549
 ENG:3.0L-SC-V6-PETROL TRN:Manual

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
------	--------	------	------	-------	------	-----	-------

A DIAG AND REPORT, CUSTOEMR WAS UNABLE TO SHIFT VEHICLE OUT OF GEAR
 ONE, VEHICLE WAS AT OPPERATION TEMPRATURE


CAUSE: .
 26 TRANS. MANUAL
 402 WJ (N/C)
 426 WJ (N/C)
 PARTS: 0.00 LABOR: 0.00 OTHER: 0.00 TOTAL LINE A: 0.00

24139 Road tested the vehicle from a warm state - shifts normal at
 each stop light. Checked the underside of the vehicle for damage: none.
 Checked transmission fluid level: normal level - note: oil leak found -
 line added. Will overnight road test to confirm transmission operation.

B** Oil leaking under the vehicle
 CAUSE: .

VINSP-23 INSPECT FOR OIL LEAKS
 402 WJ (N/C)
 426 WJ (N/C)
 1 T2R18722 BELT-DRIVE (N/C)
 1 STC50550 SEALER - ADHESIV (N/C)
 2 C2P14025 SEAL (N/C)
 1 JLM209723 ANTIFREEZE (N/C)
 2 C2Z17249 GASKET (N/C)
 1 C2Z17248 GASKET-INDCTN MA (N/C)
 1 AJ813860 TUBE (N/C)
 1 C2Z30691 HOSE-FUEL (N/C)
 2 C2D24387 KIT-INJECTOR-RE- (N/C)
 3 C2D3527 SEAL-SPARK PLUG (N/C)
 1 C2Z28262 O-RING (N/C)
 1 AJ813917 TUBE (N/C)
 1 C2D49052 BELT-DRIVE (N/C)
 1 AJ813595 GASKET-CAMSHAFT (N/C)
 1 AJ813865 PIPE-OUTLET (N/C)

PARTS: 0.00 LABOR: 0.00 OTHER: 0.00 TOTAL LINE B: 0.00
 24139

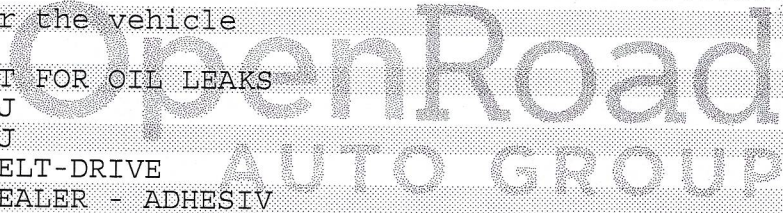

COLOUR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN / OUT	TAG	
	16	JAGUAR F-Type	SAJXB6FC1G8K27692		24139/24139	T7692	
DEL. DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
28SEP15 IS							
16FEB19 DD	16JUN15		17:30 26FEB19		0.00	CASH	05MAR19
R.O. OPENED	READY	OPTIONS: SOLD-STK:P1683 DLR:RO549					
13:45 26FEB19	13:09 05MAR19	ENG:3.0L-SC-V6-PETROL TRN:Manual					

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
Checked under the vehicle - oil leaking down the right front side of the engine. Leaking at the joint between valve cover and front cover. Requires right valve cover, high pressure fuel lines and front cover to repair the leak. Parts request sent.							
426 performed timing cover right bank reseal, valve cover gasket, super charger gasket and cooler. as well as components removed to perform timing cover job,							

