



S-TYPE

DATE 11/04

S204-12

**SERVICE**

**TECHNICAL BULLETIN**

Premature Wear On Inner Tread Edge –  
Front Tires –  
Modified Toe Specification

MODEL 2003 MY-ON  
S-TYPE  
VIN M44998-ON

**Issue:**

Some 2003 MY-ON S-TYPE vehicles may exhibit excess wear on the inner edge of the front tire treads.

A modified toe setting of +0.1° total toe has been authorized to address this concern.

**Action:**

In case of a customer complaint of premature wear on the inner edge of the front tires, check and adjust the front suspension toe setting to the modified setting of +0.1° (+0° 06') total toe (set equally left-hand-side and right-hand-side).

Refer to Global Technical Reference GTR Workshop Manual, section 204-00, SRO 57.65.01.

**Global Technical Reference (GTR) Workshop Manual Information:**

Dealer access: <https://hub.franchise.jaguar.com> Internet access: <http://www.jaguartechno.com>

**Parts Information:**

N/A

**Warranty Information:**

Warranty claims should be submitted quoting the information found in the table below. This will result in payment of the stated time and, where applicable parts/miscellaneous expense codes as listed.

Description	SRO	Time	Causal Part Number
Front toe adjustment	57.65.14	0.6 hrs.	XR8 41320

**NOTE: THE INFORMATION IN TECHNICAL BULLETINS IS INTENDED FOR USE BY TRAINED, PROFESSIONAL TECHNICIANS WITH THE KNOWLEDGE, TOOLS, AND EQUIPMENT TO DO THE JOB PROPERLY AND SAFELY. IT INFORMS THESE TECHNICIANS OF CONDITIONS THAT MAY OCCUR ON SOME VEHICLES, OR PROVIDES INFORMATION THAT COULD ASSIST IN PROPER VEHICLE SERVICE. THE PROCEDURES SHOULD NOT BE PERFORMED BY "DO-IT-YOURSELFERS." DO NOT ASSUME THAT A CONDITION DESCRIBED AFFECTS YOUR CAR. CONTACT A JAGUAR RETAILER TO DETERMINE WHETHER THE BULLETIN APPLIES TO YOUR VEHICLE.**

