



TECHNICAL BULLETIN

S501-18v2

02/2004

Subject

Remote Transmitter Function

Model: S-TYPE

Year: 2002.5

VIN M45255 to M53121

Section: 501-14

Handles, Locks, Latches and Entry Systems

Summary

This Technical Bulletin has been issued to address customer concerns of vehicles failing to unlock from the remote transmitter following the vehicle being left parked for a length of time, e.g. overnight.

This Technical Bulletin has been issued for the change in the SRO allowance and the removal of the Warranty Code and is a replacement for Technical Bulletin S501-18. Please destroy all copies of S501-18 and replace it with this Technical Bulletin S501-18v2.

Action

It is possible that following a vehicle being parked for a length of time, overnight for example, that the vehicle will not respond to the remote transmitter. If the car is then opened with the key and the ignition cycled the remote function will then operate and continue to do so until the vehicle is left parked. The concern is the result of the Driver Door Module (DDM) software not responding to the transmitter signal. To eliminate this concern a revised DDM is now available and should be installed. Should a customer express concern, follow the workshop procedure outlined below.

Workshop Procedure

- 1 Open luggage compartment lid.
- 2 Disconnect battery (see Workshop Manual, JTIS CD ROM, section: 414-01).
- 3 Install new DDM (see Workshop Manual, JTIS CD ROM, section: 419-10).
- 4 Connect battery (see Workshop Manual, JTIS CD ROM, section: 414-01).
- 5 Close luggage compartment lid.

Parts Information

The following parts must be ordered via Jaguar Cars Parts Operations (or through NSC/Importer).

Description	Part Number	Quantity
Driver door module	XR8 38268	1

Warranty Information

Description	SRO	Labor Time Allowance	Causal Part
Install new driver door module	86 80 29	0.7 Hours	XR8 38268