





# **TECHNICAL BULLETIN**

Stuck Ignition Key –

Modify J-Gate Interlock Lever –

Service Action S114

MODEL 2000 MY-ON S-TYPE

VIN

L00600-L11869

## Issue:

Some 2000 MY S-TYPE vehicles within the above VIN range may, under high temperature conditions, experience a malfunction of the J-Gate interlock mechanism which results in the inability to remove the ignition key when the gear selector lever is placed in 'Park'.


This bulletin provides a procedure to install an e-clip on the pivot bolt to increase the clearance of the pivot of the interlock lever.

# Action:

Check if the service action has already been performed on the vehicle by performing a DCS claim search. If the service action has not yet been performed, modify the interlock lever of all 2000 MY S-TYPE vehicles within the above VIN range before sale or at the first service opportunity. Install the e-clip using the procedure outlined in this bulletin.

# MODIFYING PIVOT BOLT OF INTERLOCK LEVER

- 1. Fully apply the parking brake. Release the snap fastener of the boot on the parking brake lever.
- 2. Lift up the lid of the center console.
- 3. Move the gear shift selector lever to 'Neutral'.
- 4. Raise the upper console. (Clips may become detached there is a total of 7 clips).
- 5. Reach under the console to detach the electrical connectors for the Traction Control Switch, Sports/Normal mode switch, cigar lighter and phone connections, where applicable.

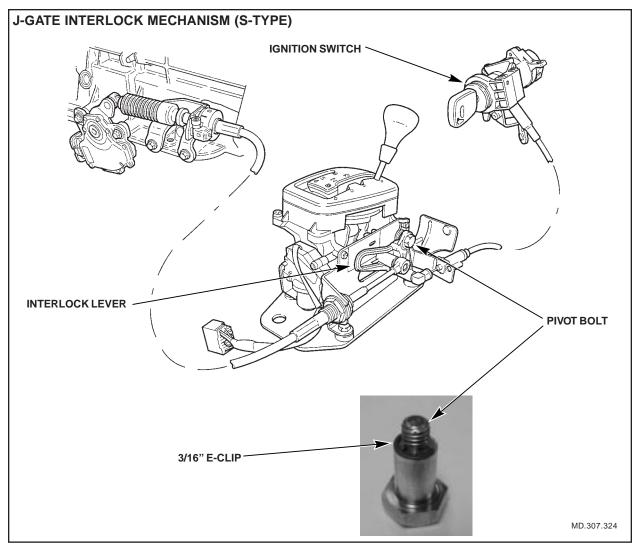

**ILLUSTRATION 1** 

- 6. On the right side of the J-gate assembly, remove the pivot bolt that retains the interlock lever (Illustration 1).
- 7. Check for any excess thread locking compound on the interlock lever. Wipe off any excess.
- 8. Install a 3/16 inch e-clip on to the bolt (Illustration 1), **ensuring that the e-clip does not extend beyond the shank of the bolt**. **Make sure that the bolt turns freely in the lever.** If necessary, use a reamer to bevel the opening of the lever.
- 9. Reinstall the bolt. Do not use thread locking compound.
- 10. Ensure that the interlock lever moves freely and that the key can be easily removed when the range selector lever is in 'Park'.
- 11. Reassemble the console components in the vehicle.

DESCRIPTION	PART NUMBER	QTY
E-clip	JAG 000099	1

#### Warranty Information:

Service Action S114

VEHICLE	<u>SUMMARY</u> <u>CODE</u>	DESCRIPTION	<u>r.o.</u> <u>NUMBER</u>	<u>TIME</u> <u>ALLOWANCE</u>
S-TYPE 2000 MY VIN L00600-L11869 Model codes 6100, 6300, 6310	BX	Install e-clip on pivot shaft -without drive-in/out time (performed with another repair.)	44.91.23	0.25 hrs.
S-TYPE 2000 MY VIN L00600-L11869 Model codes 6100, 6300, 6310	BZ	Install e-clip on pivot shaft -with drive-in/out time (only repair performed)	44.91.23 10.10.10	0.25 hrs. 0.15 hrs.

**NOTE:** Always perform a DCS claim search first to determine whether this service action has been performed on this vehicle. The warranty selection under the vehicle inquiry will give a listing of all claims against the vehicle. If S114 appears in the fault code field, do not perform this service action.

## CLAIM SUBMISSION PROCEDURE:

Warranty summary codes have been assigned to this service action in order to simplify claim submission. The dealership will be reimbursed the parts and labor time allowance as indicated.

## DCS DEALERS

Submit claims using the appropriate summary code for the vehicle model and work performed. Follow standard campaign submission procedures.

## NON-DCS DEALERS

Submit claims on the Recall Campaign Summary form W-25. Enter the appropriate summary code for the vehicle model and work performed in the Repair Code column. Do not use the W-1 warranty claim form.