

**S-TYPE**

DATE 08/03

S307-13

SERVICE

TECHNICAL BULLETIN**MIL Illumination –
DTC P0741 –
Replace Torque Converter****MODEL** 2003 MY S-TYPE
3.0L, 4.2L NA,
4.2L S/C
VIN 3.0L M45255-M83148
4.2 NA M45255-M84213
4.2 S/C M45255-M88335**Issue:**

Some of the above vehicles may exhibit the MIL illuminating with Diagnostic Trouble Code (DTC) P0741 (Torque Converter Clutch Stuck Open) logged in the Transmission Control Module (TCM) and Engine Control Module (ECM).

It has been found that there is a fault with the clutch lining of the torque converter. A modified torque converter is now available to resolve the concern.

Action:

In case of a verified customer complaint of the above condition, replace the torque converter as outlined below.

WORKSHOP PROCEDURE

1. Remove the automatic transmission assembly (see Workshop Manual, JTIS CD ROM, section: 307-01, SRO 44.20.01).
2. Place a suitable drain tray under the bell housing end of the transmission.
3. Install torque converter lifting handles (special tool number 307-139) on torque converter.
4. Displace and remove the torque converter from the transmission and place in drain tray.
5. Remove the torque converter lifting handles (special tool number 307-139) from the torque converter.
6. Install torque converter lifting handles (special tool number 307-139) to the new torque converter.

Note: Clean excess oil from transmission using a suitable cloth.

7. Install and align the torque converter onto the input shaft and align onto the oil pump drive.
8. Remove the torque converter lifting handles (special tool number 307-139) from the new torque converter.
9. Remove drain tray.

10. Install the automatic transmission assembly (see Workshop Manual, JTIS CD ROM, section: 307-01, SRO 44.20.01).

Note: For this Technical Bulletin there is no requirement to flush or renew the transmission cooler and tubes.

Parts Information:

<u>DESCRIPTION</u>	<u>PART NUMBER</u>	<u>QTY</u>
Torque converter - 3.0L V6	C2C 6701	1
Torque converter - 4.2L V8 N/A	C2C 6703	1
Torque converter - 4.2L V8 SC	C2C 6704	1
O-rings	C2C 6712	4
Transmission oil	C2C 8432	5

Warranty Information:

Model	VIN Range
2003 MY S-TYPE 3.0L	3FM45255-3FM83148
2003 MY S-TYPE 4.2L	3HM45255-3HM84213
2003 MY S-TYPE R	31M45255-31M88335

Description	SRO	Time	Causal Part Number
Install new torque converter - 3.0L V6	44.17.07	5.3 hrs.	C2S 6704
Install new torque converter - 4.2L V8 N/A	44.17.07	5.1 hrs.	C2S 6704
Install new torque converter - 4.2L V8 S/C	44.17.07	5.0 hrs.	C2S 6704

