

No.JTB00022 15 January 2007

Subject/Concern:	Vehicle Goes Into Limp-Home Mode With Diagnostic Trouble Code (DTC) P2135 Stored
	P2135 Stored

Models:		
The New XK	Gasoline Only	Gasoline Only VIN-range: B00379-B14316
S-TYPE	Gasoline Only	Gasoline Only VIN-range: N52048-N80181
XJ Range	Gasoline Only	Gasoline Only VIN-range: G49701-H15791

Markets: All Section: 303-14

Summary:

The vehicle goes into limp-home mode and displays a restricted performance message with DTC P2135 stored. The vehicle displays a loss of power and poor acceleration.

Cause: Under specific conditions the pedal demand sensor adaptions can adapt to a level that

is determined to be a failure condition.

Action: Should a customer express concern, re-configure the Engine Control Module (ECM)

using Integrated Diagnostic System (IDS). Follow the Service Instruction outlined

below.

Labour Time:				
Operation Description	Operation No.	Time		
Re-configure the existing ECM	86.99.13	0.3 hours		

Repair/Claim Coding:		
Calical Part	XJ/S-TYPE 3.0L - C2C29832 - 4.2L N/A - C2C 29833 - 4.2L SC - C2C 29834 -	
	XK N/A - C2P 5896 - SC - C2P 9622	
ACES Condition	N/A	
Code:		
Defect Code:		

Service Instruction



CAUTION: This procedure requires IDS DVD104 Patch File 5 software or

later.

Connect an approved battery charger/power supply to the vehicle.

- 2. Connect IDS to the vehicle and begin a new diagnostic session, by entering the correct VIN for the current vehicle.
- 3. Follow the IDS prompts to read the vehicle configuration file (CCF) uploads.
- 4. When prompted 'Do you wish to read diagnostic trouble codes?', select 'YES' and then press 'tick' to continue. Follow all on-screen instructions to clear the fault code.
- 5. When the fault codes have been cleared select 'Vehicle Configuration' then 'Model Programming', from the menu select 'Configure Existing Modules'.
- 6. Select and run 'Engine Control Module (ECM)'.
- 7. Follow all on-screen instructions to complete this task.
- $\boldsymbol{8}$. When the task is completed, exit the current session.
- 9. Disconnect IDS and the battery charger/power supply.

©2007 Jaguar