



X-TYPE

DATE 01/04
Amended 02/04

XT501-10

SERVICE

TECHNICAL BULLETIN

Remote Transmitter Not Functioning –
Internal Chip Fault –
Replace Transmitter

MODEL 2002-04 MY
X-TYPE
VIN C00001-D82662

Remove and destroy Bulletin XT501-10, dated 01/04.
Replace with this Bulletin.
Revisions are marked with a bar and in **bold text**.

Issue:

On some 2002-04 MY X-TYPE vehicles, within the above VIN ranges, the transmitter remote may not lock/unlock the vehicle. This condition may be caused by an internal chip fault.

Action:

In case of a customer complaint that the remote transmitter is not locking/unlocking the vehicle, **and there is no fault found with the remote transmitter battery**, supply a new remote transmitter and program it to the vehicle as outlined below.

1. Install the new remote transmitter to the key assembly.
2. Using Worldwide Diagnostic System (WDS) program the new remote transmitter to the vehicle.

Note: All other functional transmitters programmed to the vehicle are required when carrying out this procedure.

Parts Information:

<u>DESCRIPTION</u>	<u>PART NUMBER</u>	<u>QTY</u>
Alarm key remote 315 MHz	C2C 24317	1

Warranty Information:

Description	SRO	Time	Causal Part Number
Install and program new remote transmitters	86.93.29	0.3 hrs.	C2C 24318

NOTE: The information in Technical Bulletins is intended for use by trained, professional technicians with the knowledge, tools, and equipment to do the job properly and safely. It informs these technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by "do-it-yourselfers." Do not assume that a condition described affects your car. Contact a Jaguar retailer to determine whether the Bulletin applies to your vehicle.

