

TECHNICAL BULLETIN

JTB00280v4

20 OCT 2014



© Jaguar Land Rover Limited
All rights reserved.

This reissue replaces all previous versions. Please destroy all previous versions.

This bulletin supersedes TSB JTB00280v3/2014 dated 20 FEB 2014, which should either be destroyed or clearly marked to show it is no longer valid (e.g. with a line across the page). Only refer to the electronic version of this Technical Bulletin in TOPIx.

Changes are highlighted in gray

SECTION: 501-00

Front Overhead Console Lights Turn On And Off Unexpectedly

AFFECTED VEHICLE RANGE:

XF (X250)

Model Year: 2009-2013

VIN: R00019-U08775

MARKETS:

All

CONDITION SUMMARY:

Situation:

A customer may report a concern that the front overhead console lights turn on and off unexpectedly.

This version has been issued for a change to the Causal Part.

Cause: Electrical inputs from the vehicle system. **Suggested Customer Concern Code L25.**

Action: Should a customer express concern, follow the Service Instruction outlined below.

PARTS:

Kit - carbon contact pad service

C2D38636

Quantity: 1

TOOLS:

No Tools Required

WARRANTY:



NOTE: Repair procedures are under constant review, and therefore times are subject to change; those quoted here must be taken as guidance only. Always

refer to TOPIx to obtain the latest repair time.



NOTE: DDW requires the use of causal part numbers. Labor only claims must show the causal part number with a quantity of zero.

DESCRIPTION	SRO	TIME
Roof console electrical contact protection	10.10.99	0.2 hours



NOTE: Normal Warranty procedures apply.



NOTE: Repair procedures are under constant review, and therefore times are subject to change; those quoted here must be taken as guidance only. Always refer to TOPIx to obtain the latest repair time.



NOTE: DDW requires the use of causal part numbers. Labor only claims must show the causal part number with a quantity of zero.

DESCRIPTION	SRO	TIME (HOURS)	CONDITION CODE	CAUSAL PART
Roof console electrical contact protection	10.10.99	0.2	42	C2Z12623PVJ



NOTE: Normal Warranty procedures apply.

SERVICE INSTRUCTION:




WARNING: Prior to touching the PCB it is advised that your hands are clean and you have earthed your body out by touching the steel work bench.

1. Remove the interior light (see TOPIx Workshop Manual, section 501-00).
 - Follow steps 1 and 2 only.


2.  **NOTE: Make sure no damage is caused when disconnecting the electrical connectors.**

Disconnect the two electrical connectors.

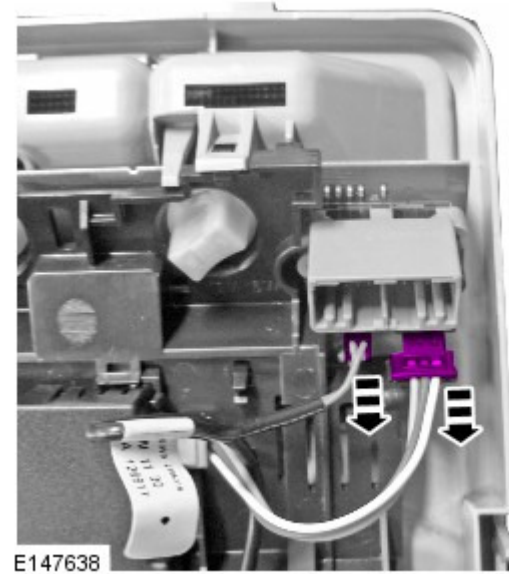


3.  **NOTE: Some items removed for clarity in graphic E99887.**

Move aside the black plastic cover.

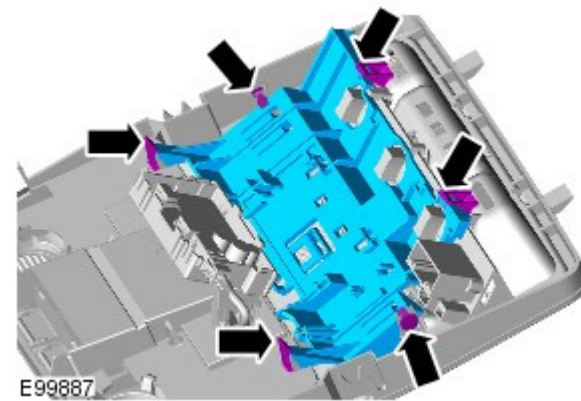

4.  **NOTE: Make sure no damage is caused when releasing the PCB.**

Release the main circuit board.


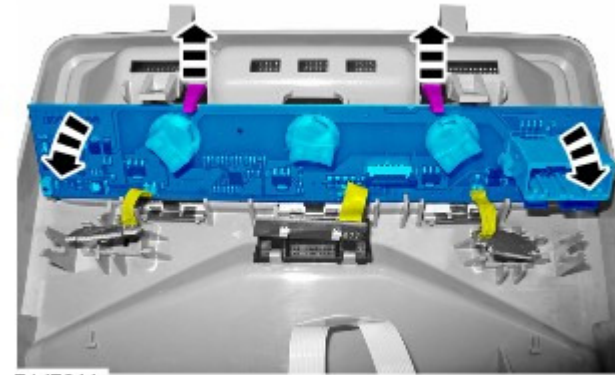


E147644

5.  **NOTE: Make sure all the grease is removed from the electrical connectors.**

Using a suitable clean cloth remove the grease from the three electrical connectors.

- Using the wipe supplied in the kit make sure all the grease is removed from the electrical connectors.

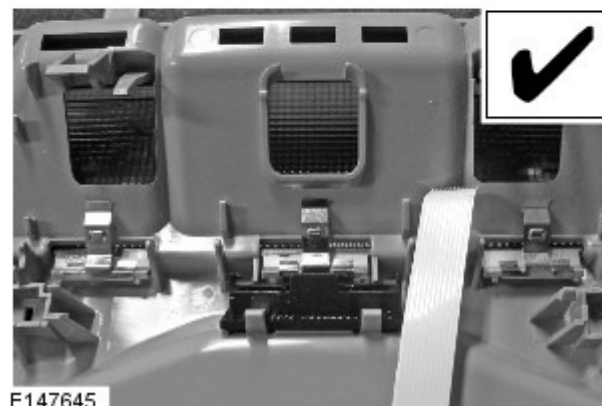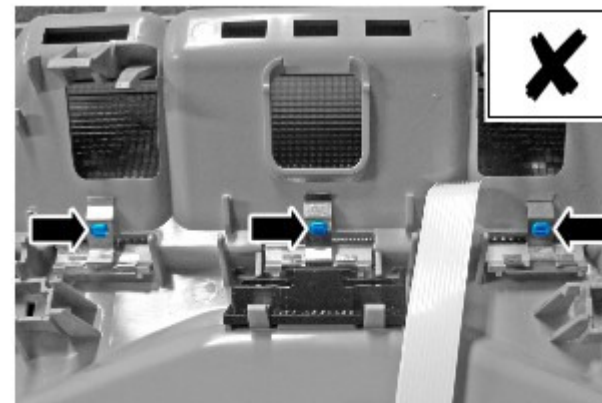


6.  **CAUTION:** When installing the rubber sleeves it is important not to damage or split them.

 **NOTE:** Install all three sleeves from the top.

Install the three rubber sleeves to the electrical connectors.


- The rubber sleeves must be approximately 2-3mm from the bottom of the electrical connector.

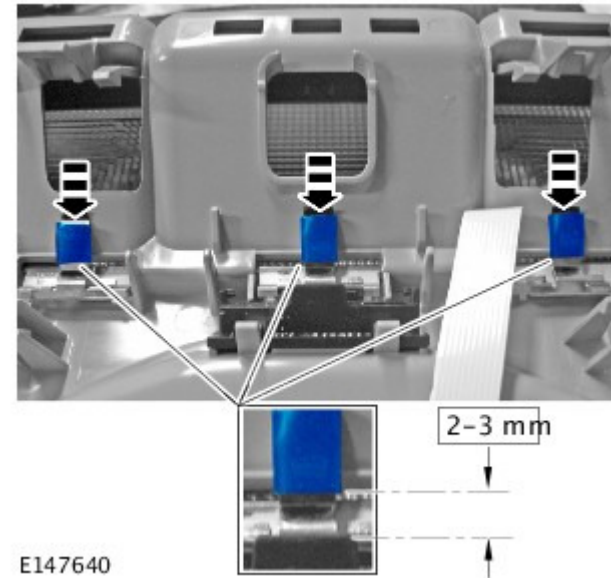


7.  **NOTE:** Make sure no damage is caused when installing the PCB.

 **NOTE:** Locate the PCB into the four locating fixings before clipping the PCB into position.

Install the PCB.

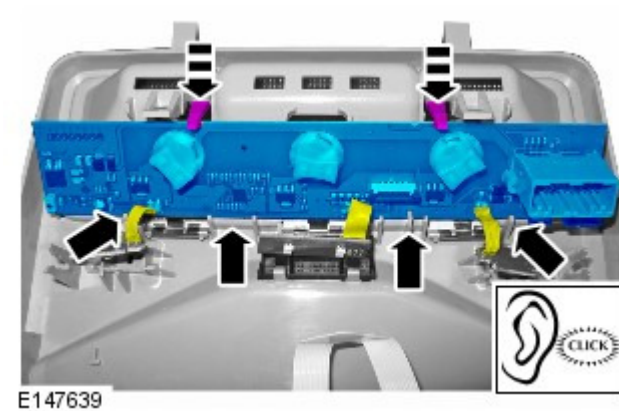

8. Install the black plastic cover.

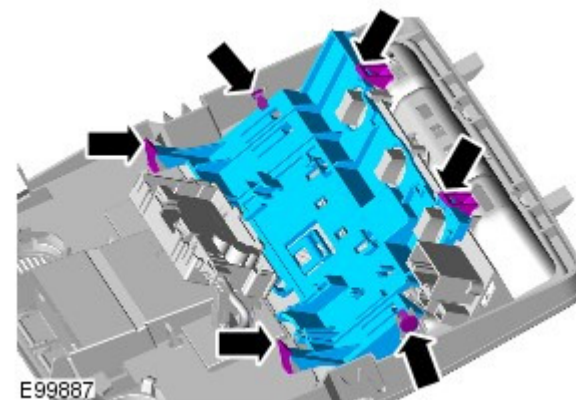

9.  **NOTE: Make sure no damage is caused when installing the electrical connectors.**

Connect the two electrical connectors.



10. Install the interior light, (see TOPIx Workshop Manual, section 501-00).

- Follow steps 2 and 1 only.

11. Check the interior lamps are functioning correctly.