

SSM42914 - Transmission Control Module (TCM) New/Existing Configuration

Id	42914
Models	X350 - XJ X100 - XK Series X200 - S TYPE
Title	Transmission Control module (TCM) New/Existing configuration
Last Modified	16-DEC-2009 17:48
Category	Diagnostic Software/Hardware
Symptom	000101 Diagnostic Concerns

Issue:

Transmission Control module (TCM) failure after attempting to download software or running adaption clear routine with IDS DVD 118.5 Patch 20.

Cause:

When running *Transmission Control module* TCM Programming IDS runs *Transmission Control module* TCM adaption routine at the first stage of the application.

Content This causes software to be removed from the *Transmission Control module* TCM which is critical for software download, IDS will then lose communications with the module, reporting an error Verona 20:61.

Action:

This is resolved on IDS DVD 119 Patch 1, do not run *Transmission Control module* (TCM) programming on S-Type, XJ and XK until IDS DVD 119 Patch 1 is installed.

If you have already attempted programming and lost communication with the *Transmission Control module* (TCM), please contact your Technical Support team.