Module	Connector-Pin#	Wire Color	Connector Type	Location
Central Microprocessor	LB13-14 LB13-15	KG-Pink/Green KR-Pink/Red	36-way PMHD Black	One of two CPU pigtails
Instrument Pack	LB54-32	KS-Pink/Slate	36-way PMHD Black	Below Instrument Pack, beside steering column

Disabling '88-'92 XJ40 Bulb Failure Warning

Back out or snip the indicated wire at the indicated connector location. This will disable the bulb failure warning and leave the bulb failure module disconnect loop intact. I usually removed the terminal from the connector; that way it's easily reversible.

Locate a copy of the appropriate Electrical Guide and match the wire colors, and confirm adjacent wire colors to be sure you have the correct wire.

Disabling '93-'94 XJ40 Bulb Failure Warning

Module	Connector-Pin#	Wire Color	Connector Type	Location
Central Microprocessor	LB61-21 LB61-22	KG-Pink/Green KR-Pink/Red	48-way AMP PCB Black	One of three connectors on CPU
Instrument Pack	LB23A-12	KS-Pink/Slate	12-way Multilock 040 Blue	Mounted on LH Blower Motor

 Tiz Widewater (off N. 901)
 111 West Collins University

 Latayette, IN 47904
 Fort Wayne, IN 46825

 (317) 742-5061
 (219) 483-0525

 WATE 1. 800-382-3663
 WATE 1. 800-382-3613
CPY LB13-14 KG) Disconnect RTarn LB13-38 K4) Disconnect LTarn 36- Way BIK PMHD Enst. Pack LB54-32 KS > Disconnect Gen Fail 36-Wan Blk Pmit D Defeat 88-89 B/Fail activation -Disconnect Loop Futact

Revision 2 ©SPetry 6/14/2012 Indianapolis, IN