



MODEL
2007 XK

DATE
08 Feb 2007

NUMBER
XK501-007

SERVICE

TECHNICAL BULLETIN

SECTION: 501-05 – INTERIOR TRIM AND ORNAMENTATION

Cargo Cover Retention

AFFECTED VEHICLE RANGE:

New XK VIN: B00125 to B07723
Model Year: 2007

CONDITION SUMMARY:

CARGO COVER RETENTION

Situation: A concern may be reported that the luggage compartment cargo cover trim is loose. This condition may be caused by the retaining clamp toggles coming loose from the body.

Action: Should this concern be expressed, refer to the Repair Procedure detailed in this bulletin to install washers to the retaining clamp toggle assemblies.

PARTS:

C2P 14343Washer Qty 4

WARRANTY:

NOTE: Repair procedures are under constant review, and therefore times are subject to change; those quoted here must be taken as guidance only. Always refer to DDW to obtain the latest repair time.

DDW requires the use of causal part numbers. Labor only claims must show the causal part number with a quantity of zero.

<i>Description</i>	<i>SRO</i>	<i>Time (Hours)</i>	<i>Condition Code</i>	<i>Causal Part</i>
Install washers to the cargo cover retaining clamps	76.95.23	0.2	N/A	C2P 1479LEG



Normal warranty policy and procedures apply.

NOTE: The information in Technical Bulletins is intended for use by trained, professional technicians with the knowledge, tools, and equipment required to do the job properly and safely. It informs these technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by "do-it-yourselfers." If you are not a Retailer, do not assume that a condition described affects your vehicle. Contact an authorized Jaguar service facility to determine whether the bulletin applies to a specific vehicle.

REPAIR PROCEDURE

INSTALL WASHERS TO THE CARGO COVER RETAINING CLAMPS

1. Open the trunk.
2. Undo the forward toggle clamps by rotating down and forward. (Upper Figure 1)
3. Pull the front edge of the tray away from the tailgate, to disengage the toggle clamps from the holes in the body. (Lower Figure 1)
4. Slide the rear retainers from the grommets in the body, by carefully pulling the tray down and forward. (Figure 2)

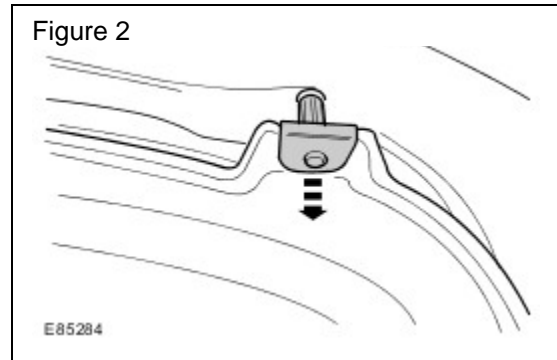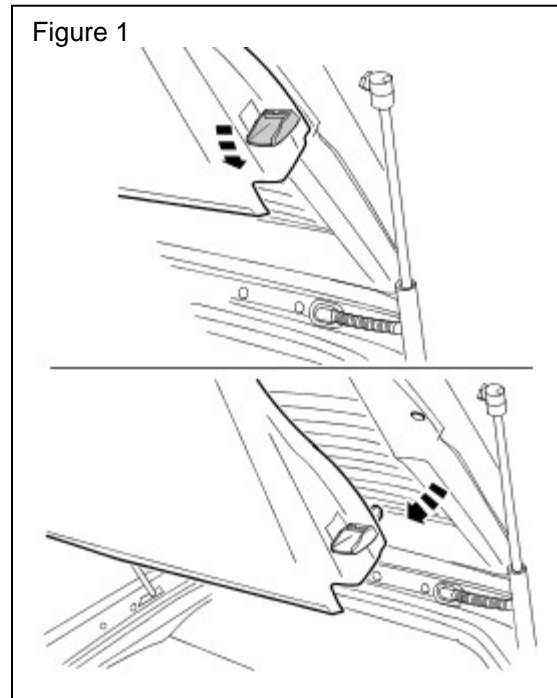

5. Remove the cargo cover from the vehicle and place on a clean, flat surface.
6. Holding the plastic nut of a toggle clamp assembly, as shown in Figure 3, turn the toggle handle counter-clockwise until the nut and rubber ring are released. (Figure 3)

Figure 3




7. Install two (2) washers between the top surface of the cover board and the rubber ring. (Figure 4)



NOTE: The toggle handle should only need to be turned clockwise for six full turns.


8. Assemble the toggle clamp assembly as follows:
 - Holding the plastic nut of the toggle assembly, turn the open toggle handle clockwise until the rubber ring starts to swell/compress.
 - Position the open toggle handle so that it is in line with the cover as shown in Figure 7.

Figure 4

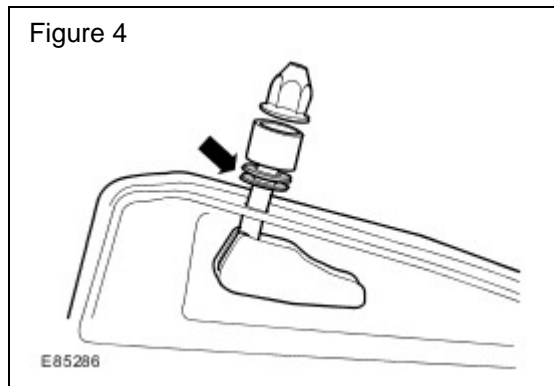

9. Ensure the two rubber grommets on the body are in place and not distorted. (Figure 5)


Figure 5

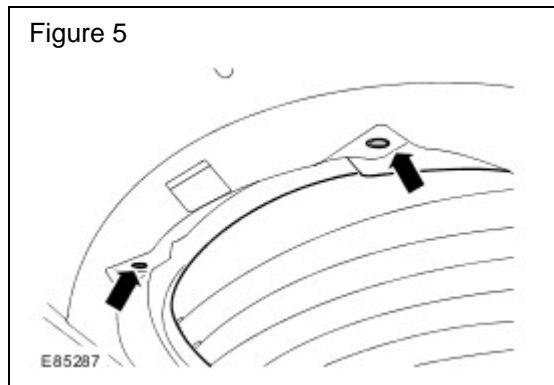


10. Perform steps 6 to 9 to the opposite side toggle clamp assembly.

11. Push the rear hangers completely into the grommets on the body. (Figure 6)


Figure 6

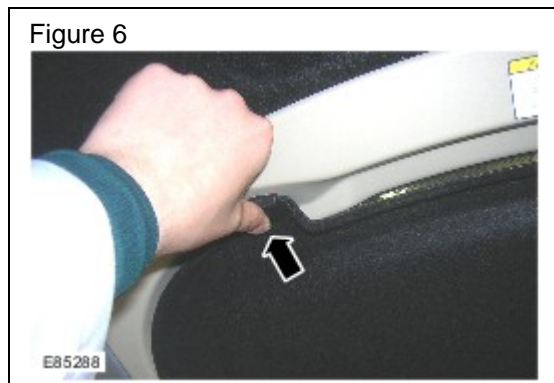

12. Push the cover's front end retainers into the holes in the body through the upper trim. (Figure 7)
13. While pushing firmly towards the body, close the toggle clamp. (Figure 7)

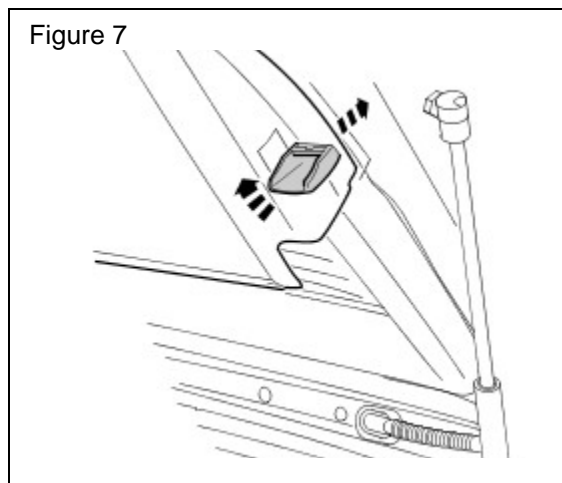

14. Gently pull the front edge of the cover away from the trunk lid, to confirm that the toggle clamps are secured in the body. (Figure 8)

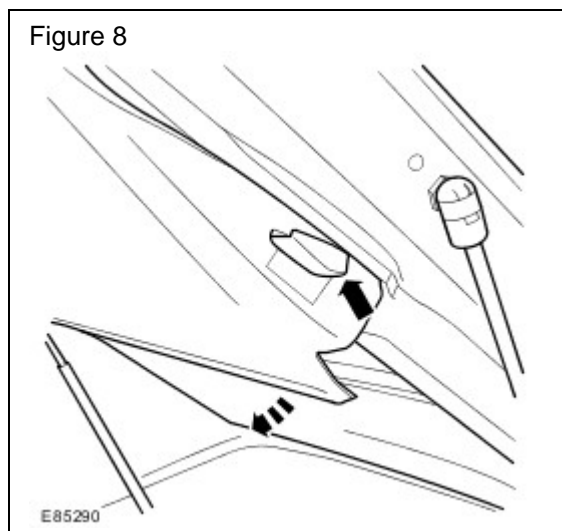

15. Close the trunk.