

TECHNICAL SERVICE BULLETIN

reissue No. **JTB00008v2/2006**

02 February 2007

Circulate to:	Service Manager	Parts Manager	Warranty Administrator	Service Reception	Technicians

© Jaguar

All rights reserved.

This reissue replaces all previous versions. Please destroy all previous versions. Only refer to the electronic version of this TSB in GTR.

This bulletin supersedes TSB JTB00008/2006 dated 28 November 2006, which should either be destroyed or clearly marked to show it is no longer valid (e.g. with a line across the page). Only refer to the electronic version of this TSB in GTR.

Subject/Concern:	Creak from Front Brake Caliper	
Model:		
The New XK - Normally Aspirated	VIN Range: B00379-B15857	
S-TYPE - Normally Aspirated and Diesel Only	VIN Range: N52048-N80901	
XJ Range - Normally Aspirated	VIN Range: G49701-H16364	

Markets: All
Section: 206-03 - Front Disc Brake

Summary

This bulletin addresses customer concerns of a creak noise emanating from the front brakes with light brake application, at slow speed, and manoeuvring the steering. The noise can also be heard when coming to a stop in the straight-ahead position with light or medium braking.

Version 2 of this Bulletin has been issued due to the addition of final VINs and a change in Parts Required.

Cause: Front brake caliper to brake pad anchor interface.

Action: Should a customer express concern, install new modified front brake pads. Follow the Service Instruction outlined below.

Parts Required

Description	Part Number	Quantity
Front brake pads	C2C 35612	1
Grease sachet	C2C 33568	1

Repair procedures are under constant review, and therefore times are subject to change; those quoted here must be taken as guidance only. Always refer to DDW to obtain the latest repair time.

Labor Time

Operation Description	Operation No.	Time
Brake noise - Service fix - New XK	70.40.02	0.5 hours
Brake noise - Service fix - S-TYPE	70.40.02	0.7 hours
Brake noise - Service fix - XJ Range	70.40.02	0.6 hours


Repair/Claim Coding

Causal Part:	C2C 35612
ACES Condition Code:	N/A

Service Instruction

1. Remove front brake pads (see Global Technical Reference GTR Workshop Manual, section: 206-03).

2. Clean and apply grease to the front brake caliper (see E68484).

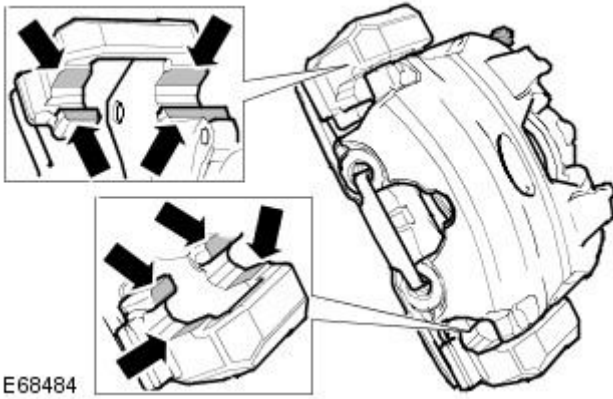

E68484

3. Carry out step 2 to the opposite side front brake caliper.
4. Install new front brake pads (see Global Technical Reference GTR Workshop Manual, section: 206-03).