

Reference SSM30918

Models X150 / XK

Title Service action S856 - concerns addressed.

Category Diagnostic Software Hardware

Last modified 20-Apr-2007 00:00:00

Symptom 000102 WDS Patch / Update

This SSM has been released to clarify which concerns have been addressed in service action S856 ♦ Software Enhancement Program. The following is a brief description of the function change / improvement:-

Start authorization

- The revised software addresses the non start concern referred to as the "race start condition" where the customer presses the start button at the same time as closing the driver's door thus beating the passive start authorization.

Cluster over temperature issues

- Content
- The cluster over temp issue is identified when one or both of the Instrument cluster needles display maximum and the message display centre flashes on / off continually. This concern is mainly isolated to hotter climates.

Ignition on chirp when car is locked

- This feature has been introduced to alert the customer with a chirp should the ignition have been left on when attempting to lock the vehicle.

Short door-glass drop


- The revised software addresses the issue where the door glass intermittently fails to drop, this can cause the door glass to sit outside the cantrail seal.

Power fold mirror operation

- New software gives the customer the ability to automatically fold the exterior rear view mirrors when locking the vehicle. This feature is switchable via the HLDF screen

needles do not return to the zero
position

SRS logged DTC U0001  88

- SRS light on DTC U001  88
logged