



XK

DATE 11/03

303-62

SERVICE

## TECHNICAL BULLETIN

Ticking Noise From Left side Footwell –  
EVAP Canister Purge Valve –  
Repair Procedure

MODEL 2003-04 MY  
XKR  
XK8  
VIN A30645-A36998 (SC)  
A30645-A37134 (NA)

**Issue:**

On some 2003-04 MY XK vehicles within the above VIN ranges, customer may have concerns about a ticking noise coming from the left hand footwell area at low speeds.

A modified Evaporative Emissions (EVAP) Canister Purge Valve is now available to address this concern. After installing this valve the Engine Control Module (ECM) must be reprogrammed.

**Action:**

In case of a verified customer complaint about a ticking noise coming from the left hand footwell area at low speed, on a 2003-04 MY XK vehicle within the above VIN range, follow the workshop procedure outlined below:

WORKSHOP PROCEDURE

1. Install the new EVAP Canister Purge Valve (see Workshop Manual, JTIS CD-ROM, section: 303-13, SRO 17.15.30). Disregard the VIN change point in the instructions.

**Note:** Ensure WDS is loaded with software release JTP 759/26 or later.

2. Position WDS alongside the vehicle, switch the Portable Test Unit (PTU) 'ON' and allow the software to load.
3. Connect PTU to the vehicle using diagnostic cable.
4. Enter the vehicle VIN and navigate to configuration main menu.
5. Select and run 're-configure existing ECM' application.
6. After reprogramming of the ECM is complete, switch 'OFF' PTU, disconnect from the vehicle and return WDS to original location.

**NOTE:** The information in Technical Bulletins is intended for use by trained, professional technicians with the knowledge, tools, and equipment to do the job properly and safely. It informs these technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by "do-it-yourselfers." Do not assume that a condition described affects your car. Contact a Jaguar retailer to determine whether the Bulletin applies to your vehicle.

**Parts Information:**

**DESCRIPTION**  
EVAP Canister Purge Valve

**PART NUMBER**  
C2N 3045

**QTY**  
1

**Warranty Information:**

<b>Description</b>	<b>SRO</b>	<b>Time</b>	<b>Causal Part Number</b>
Install new EVAP Canister Purge Valve	17.15.30	0.5 hrs.	C2N 1829
Reconfigure the ECM	86.99.13	0.3 hrs.	C2N 1829