ALLDATAdiy.com - 1999 Jaguar XK-8 Convertible (X100) V8-4.0L (AJ27) - Engine Hard Start... http://www.alldatadiy.com/alldata/AFI~V25426031~C36035~R0~OD~N/0/70910848/7804127...

ALLDATA diy.com

Welcome GUS GLIKAS

Leading source of Online Diagnostic & Repair Information

Your Vehicle: 1999 Jaguar XK-8 Convertible (X100) V8-4.0L (AJ27)



Vehicle » Powertrain Management » Fuel Delivery and Air Induction » Technical Service Bulletins » All Technical Service Bulletins » Engine	
Hard Start - Diagnosis	<u>Notes</u>

Engine Hard Start - Diagnosis

310-02

XK8 DATE 12/97

Engine Hard Starting - Diagnosis MODEL 1997 MY-ON XK8 Range

VIN 001001-ON

Issue:

This bulletin provides a diagnosis procedure to follow in case of a customer complaint of poor or hard starting.

To assist in a methodical diagnosis, this bulletin includes an Engine Start Report Form which should be copied and filled out.

JAGUAR	ENGINE START REPORT FORM				
MODEL	CUSTOMER	VIN	MILES/KMS		
DEALER NUMBER		CUSTOMER DETAILS &	COMMENTS		
DESCRIPTION OF COMPLAINT					
DATE		LOCATION			
WEATHER CONDITIONS		CRANK TIME , OVER 3 SECS BUT RAN CLEAN AFTER START?			
WAS START QUALITY POOR DID IT FAIL TO ROUGH? DID IT FAIL TO		DID IT FAIL TO START?			
DETAILS OF START					
ENGINE LAST RAN?		ENGINE TEMP: COLD? PART WARM? HOT?			
KEY THROUGH TO START PO PAUSE AT IGNITION-ON POS		DID IT FIRE?			
HOW LONG TO FIRST FIRING?		WAS IT A CLEAN START?			
HOW MANY ATTEMPTS?		HOW LONG CRANKING?			
WAS CRANK SPEED UNUSUALLY FAST?		THROTTLE ASSIST? HOW MUCH? %			
BLACK SMOKE?		FUEL SMELL?			
PREVIOUS JOURNEY PRIOR TO PRESENT DIAGNOSIS					
FROM COLD?		DISTANCE/TIME?			
WARNING LIGHTS?		TYPE OF JOURNEY?			
FUELLING DETAILS					
LEVEL DURING EVENT?		LAST FILLED? TYPE OF FUEL			
LEVEL BEFORE FILLING?		LEVEL AFTER FILLING			

ALLDATAdiy.com - 1999 Jaguar XK-8 Convertible (X100) V8-4.0L (AJ27) - Engine Hard Start... http://www.alldatadiy.com/alldata/AFI~V25426031~C36035~R0~OD~N/0/70910848/7804127...



Make a copy of the Engine Start Report Form shown in this bulletin. Fill in the details of the occurrence on the copy and fax it to the Product Investigation Dept. at (201-818-9763). There are four areas which should be checked when a starting problem is encountered and they are listed in order of possibility.


TPCV SHOWI	NG TANK & CAN PORTS		
		CAN JSI-3052	
ILLUSTRATION 2			
Zoom	Sized for Print		


^Tank Pressure Control Valve, (TPCV), known as a "Rochester Valve"

^Spark Plugs

^On 1998 MY-ON vehicles, the Key Transponder Module, (KTM).

Transmission Rotary Switch/Harness

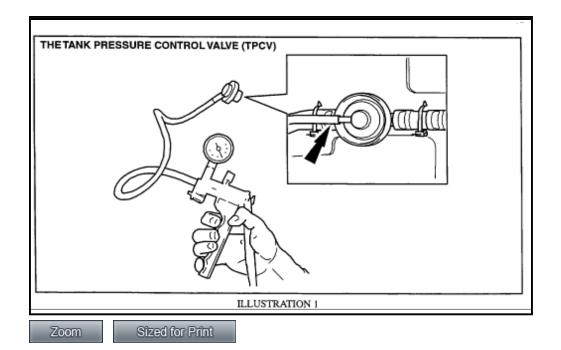

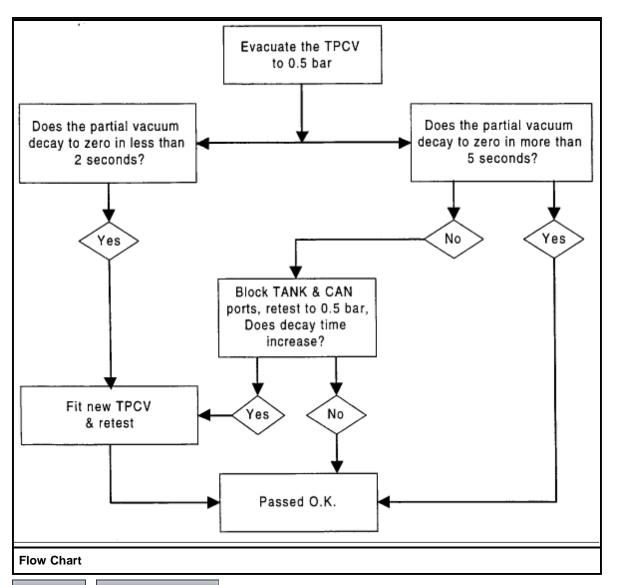

Zoom Sized for Print

TANK PRESSURE CONTROL VALVE (TPCV)

Connect a hand vacuum tester to the TPCV vacuum port, as shown in Illustration 1 and follow the flow chart.

SPARK PLUGS

If the engine failed to start, check the <u>spark plugs</u> for carbon buildup. If carbon buildup is found, the spark plugs must be changed. Set the spark plug to a revised gap of 1.3 mm (0.051 in). Check the throttle linkage to ensure that wide open throttle is possible.

ALLDATAdiy.com - 1999 Jaguar XK-8 Convertible (X100) V8-4.0L (AJ27) - Engine Hard Start... http://www.alldatadiy.com/alldata/AFI~V25426031~C36035~R0~OD~N/0/70910848/7804127...

KEY TRANSPONDER MODULE (KTM) 1998 MY-ON

^If the engine failed to start, the exact conditions of the start procedure must be reproduced before the KTM is replaced.

^A failure to start due to a KTM problem occurs when the ignition key is turned quickly through position I & II to then operate the starter motor to turn the crank, without waiting for the instrument panel warning lights to light up.

^The starter motor will turn the crank normally without the ignition firing.

^If the key is then released and turned again, as described, then the engine will fire and run normally.

^If the faulty start procedure can be reproduced, the KTM should be replaced by latest version KTM, Part Number LNC 2665AA.

^The keys must be reprogrammed to match the replacement KTM.

TRANSMISSION ROTARY SWITCH/HARNESS

If an engine can be turned by the starter motor, but fails to start and the gearchange "J gate" is not illuminated, the fault could be in the rotary switch harness. This fault can be intermittent or continuous.

DTC P0706 will be stored and DTC's P1516 and P1517 may be stored.

The cause of this fault is the entry of water into either the rotary switch or the rotary switch harness connector, either of which will require the replacement of the rotary switch and harness.

Warranty Information:

This is bulletin is issued to assist in diagnosis only. Refer to the Warranty Codes and Repair Operation Times manual for fault codes and labor times.

Account | Vehicle | Help | Contact | Exit

© 2011 ALLDATA, LLC. All Rights Reserved. Trademarks | Privacy Policy | Terms and Conditions