

S-TYPE

DATE 03/05

S501-25

SERVICE

TECHNICAL BULLETIN

Sun Visor Mirror Bulb – Now Available Separately – Replacement Procedure MODEL 2003 MY-ON S-TYPE

VIN

M44998-ON

Issue:

This Technical Bulletin has been issued to inform dealers that the sun visor mirror bulb is now available as a separate item. It is no longer necessary to replace the complete sun visor assembly when the sun visor bulb is inoperative.

Action:

Should a customer express concern, install a new sun visor bulb as outlined below.

- Open door.
- 2. Reposition sun visor downwards for access.
- 3. Using a suitable tool, release the lens/mirror assembly retaining tangs, and remove lens/mirror assembly (Illustration 1).

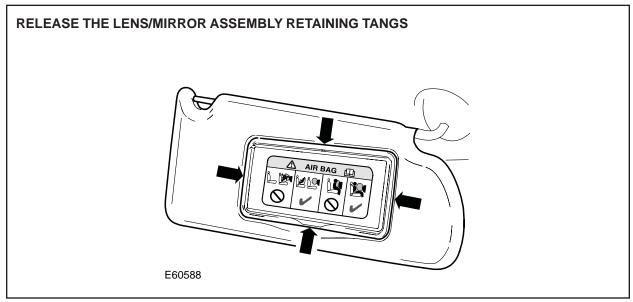


ILLUSTRATION 1

NOTE: THE INFORMATION IN TECHNICAL BULLETINS IS INTENDED FOR USE BY TRAINED, PROFESSIONAL TECHNICIANS WITH THE KNOWLEDGE, TOOLS, AND EQUIPMENT TO DO THE JOB PROPERLY AND SAFELY. IT INFORMS THESE TECHNICIANS OF CONDITIONS THAT MAY OCCUR ON SOME VEHICLES, OR PROVIDES INFORMATION THAT COULD ASSIST IN PROPER VEHICLE SERVICE. THE PROCEDURES SHOULD NOT BE PERFORMED BY "DO-IT-YOURSELFERS." DO NOT ASSUME THAT A CONDITION DESCRIBED AFFECTS YOUR CAR. CONTACT A JAGUAR DEALER TO DETERMINE WHETHER THE BULLETIN APPLIES TO YOUR VEHICLE.



- Remove defective bulb from lens/mirror assembly. 4.
- 5. Align and install the new bulb to the sun visor.

A Caution: Do not install the lens/mirror assembly with the lid fully open.

- Install lens/mirror assembly in the sun visor, check operation of sun visor and bulbs.
- 7. Close the illuminated sun visor mirror cover.
- 8. Reposition the sun visor upwards.
- 9. Close door.

Global Technical Reference (GTR) Workshop Manual Information:

Dealer access: https://hub.franchise.jaguar.com Internet access: http://www.jaguartechinfo.com

Parts Information:

DESCRIPTION PART NUMBER QTY Bulb LJA 5180BA

Warranty Information:

Warranty claims should be submitted quoting the information found in the table below. This will result in payment of the stated time and, where applicable parts/miscellaneous expense codes as listed.

Description	SRO	Time	Causal Part Number
Install one, two, three, or four new sun visor bulbs	86.45.95	0.2 hrs.	LJA 5180BA

Page 2 of 2 Bulletin Number S501-25 Date of issue 03/05

