


|                           |               |          |
|---------------------------|---------------|----------|
| S-TYPE                    | Date<br>04/99 | S 307-01 |
| <b>TECHNICAL BULLETIN</b> |               |          |

|   |  |
|---|--|
| Subject<br>GEAR SELECTOR PARK SOLENOID RELEASE<br>PROCEDURE | Model S-TYPE<br>Year 1999.25<br>VIN L00600 ONWARDS |
|---|--|

### ISSUE:

On vehicles equipped with automatic transmission, the situation may arise that the gear selector lever remains locked in the 'P' position, rendering the vehicle immobilised. While a discharged battery might be the primary cause of such a concern, other electrical malfunctions could also result in the same situation.

The following procedure will allow manual release of the interlock mechanism, allowing 'N' to be selected so that the vehicle may be moved or towed.

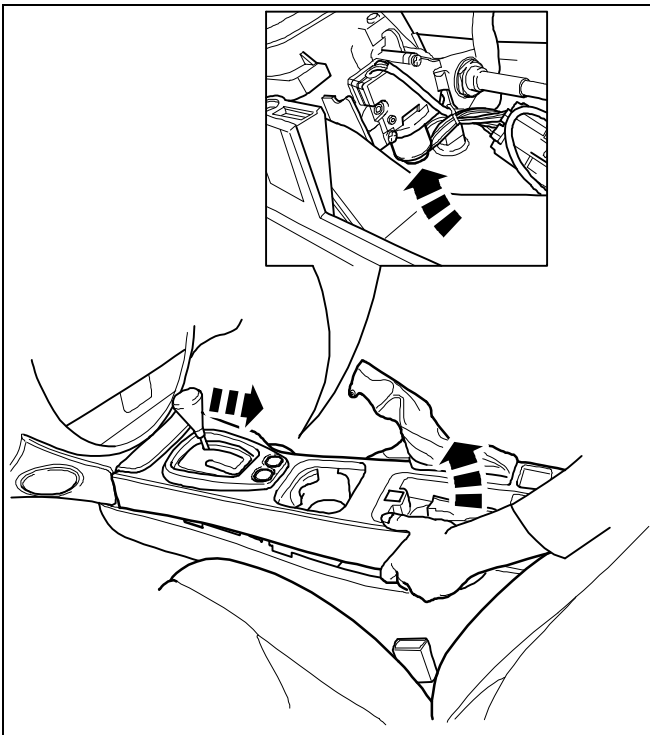

- 1 Enter left hand side of vehicle.
- 2 Pull hand brake into fully up position
- 3 Release the hand brake trim press stud.
- 4 Lift centre console lid.
- 5 Lift upper console from the rear. (Clips should stay in place)
- 6 Access to the gear shift interlock manual release is now possible.
- 7 Slide hand under right hand side of console
- 8 and raise manual release plunger.
- 9 While holding plunger in raised position, move gear selector level from 'P' to 'N'.  
Reassemble.

### NOTE:

When raising/lowering the upper console, be careful not to displace or damage the plastic trim fitted to the selector aperture.

### WARRANTY INFORMATION:

This Bulletin is issued 'for information only'.