
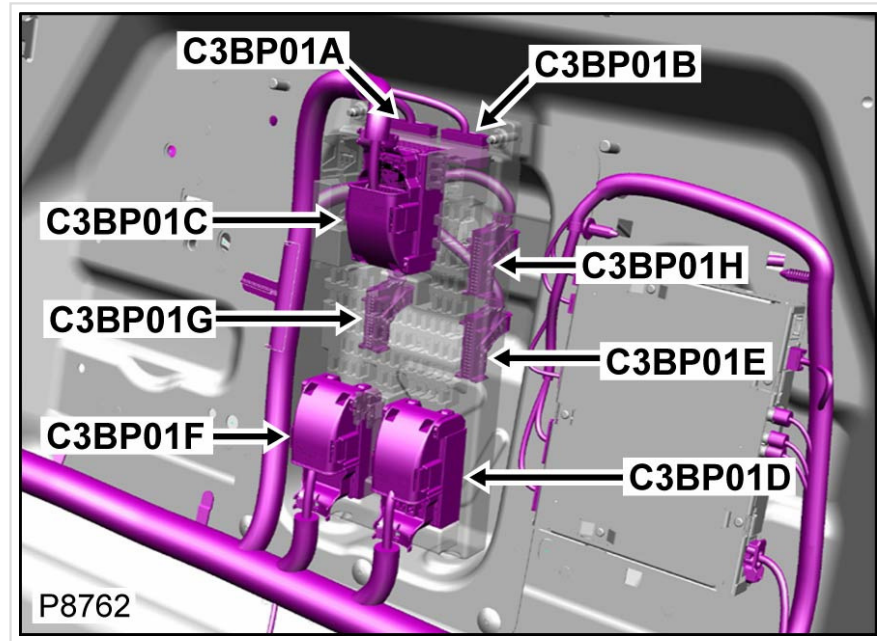


Connector Face

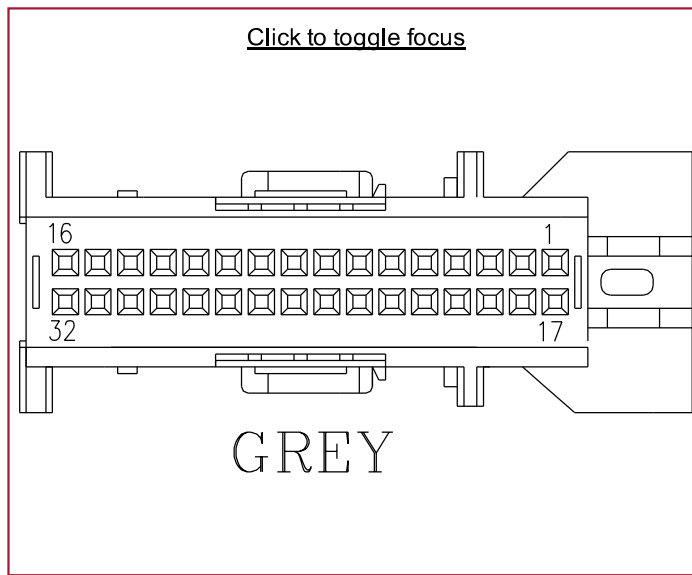

Housing Not Serviceable

Engineering Part Number 3M5T-14489-BRC

Service Part Number

Colour GREY

Cavities 32

Harness CABIN RH HARNESS

Description Junction box-Central

Location Behind rear seat backrest - Left side

Wire chart and service repair kit information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
3	0.35	BN-VT	ALL	C33-F	-	-	-	-	-	-
4	0.35	VT-GN	ALL	C33-F	-	-	-	-	-	-
5	0.75	GY-VT	ALL	C32-B	418-411-45	418-116A	418-117	418-104	418-112	418-107
6	0.35	GN-BN	ALL	C33-F	-	-	-	-	-	-
8	0.35	VT-BN	ALL	C33-F	-	-	-	-	-	-
9	0.35	WH-BN	ALL	C33-F	-	-	-	-	-	-

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
10	0.35	GN-VT	ALL	C33-F	-	-	-	-	-	-
11	0.35	GY-BN	ALL	C33-F	-	-	-	-	-	-
12	0.35	BU-GN	ALL	C33-F	-	-	-	-	-	-
13	0.35	BN-YE	ALL	C33-F	-	-	-	-	-	-
14	0.35	WH	ALL	C33-F	-	-	-	-	-	-
15	0.35	WH-GN	ALL	C33-E	-	-	-	-	-	-
16	0.35	WH-VT	ALL	C32-E	-	-	-	-	-	-
19	0.35	GY-YE	ALL	C33-F	-	-	-	-	-	-
20	0.35	YE-BU	ALL	C33-F	-	-	-	-	-	-
21	0.5	GN-OG	ALL	C32-D	418-411-45	418-116A	418-117	418-104	418-112	418-107
22	0.5	BU-WH	ALL	C32-B	418-411-45	418-116A	418-117	418-104	418-112	418-107
28	0.35	WH-BN	ALL	C33-F	-	-	-	-	-	-
29	0.5	GN-VT	BWKAD	C33-BF	-	-	-	-	-	-
29	0.5	GN-VT	BWKAA	C3R123	-	-	-	-	-	-
30	0.5	WH-VT	ALL	C3R124	418-411-45	418-116A	418-117	418-104	418-112	418-107
31	0.5	BU-BN	BWKAA	C3R125	-	-	-	-	-	-
31	0.5	BU-BN	BWKAD	C33-BC	-	-	-	-	-	-