



Door Lock Control Switch 86.80.32

Removal

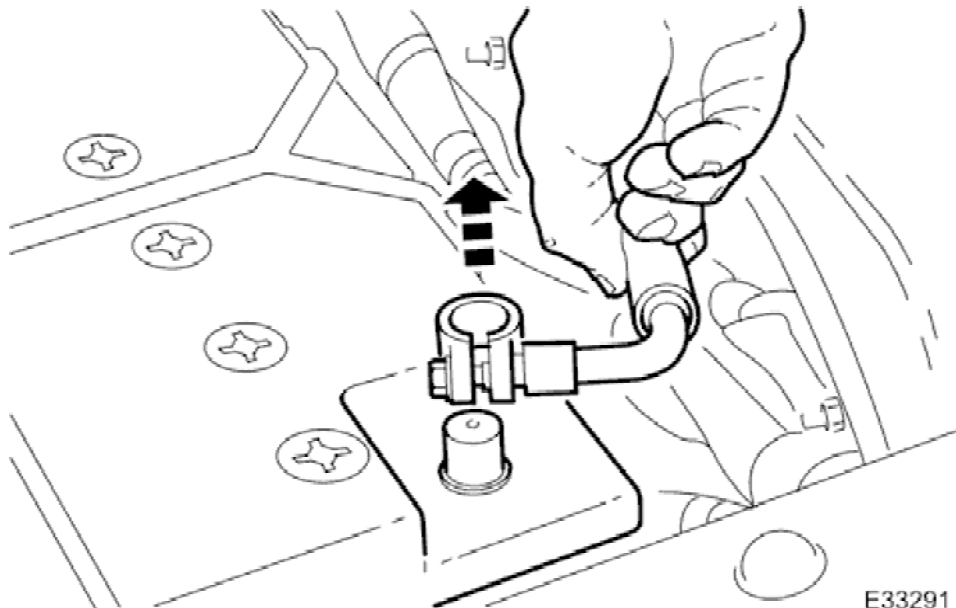

E33291

1. Disconnect battery ground cable; refer to <<86.15.19>>.
2. Remove center console veneer panel; refer to <<76.47.26>>.
3. Displace radio for access; refer to 86.50.03.

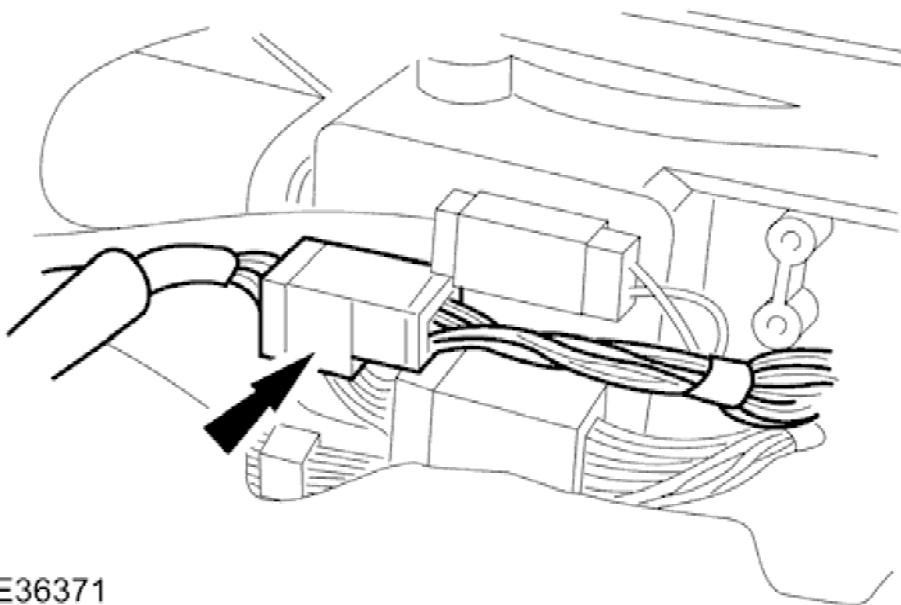


E36371

4. Disconnect air conditioning control module flying lead connector (blue) from harness connector located at


1999 XJ RANGE - Handles, Locks, Latches and Entry Systems - 501-14

side of 'J' gate.

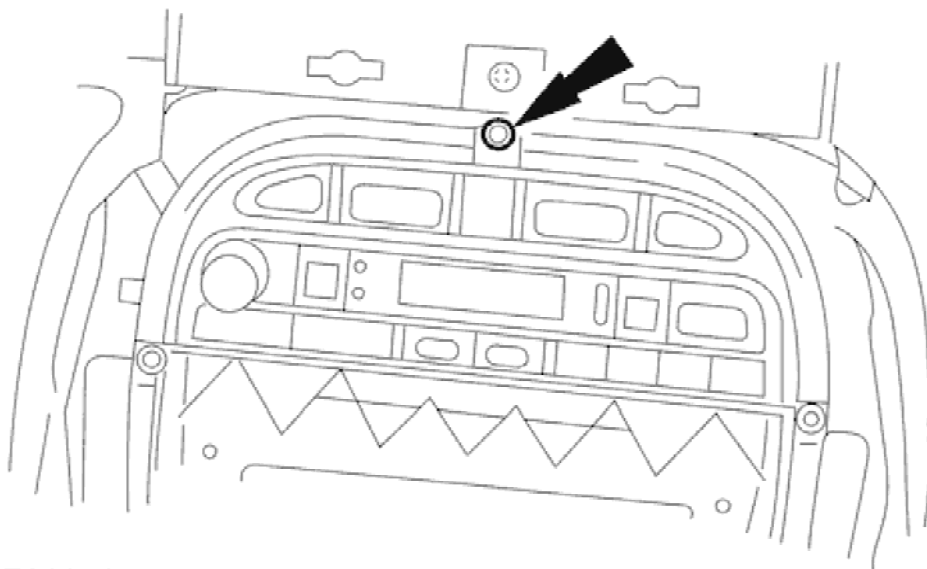


E36372

5. Displace air conditioning switch module / center console switch module assembly.
 - Remove screw.
 - Reposition assembly for access to connector.

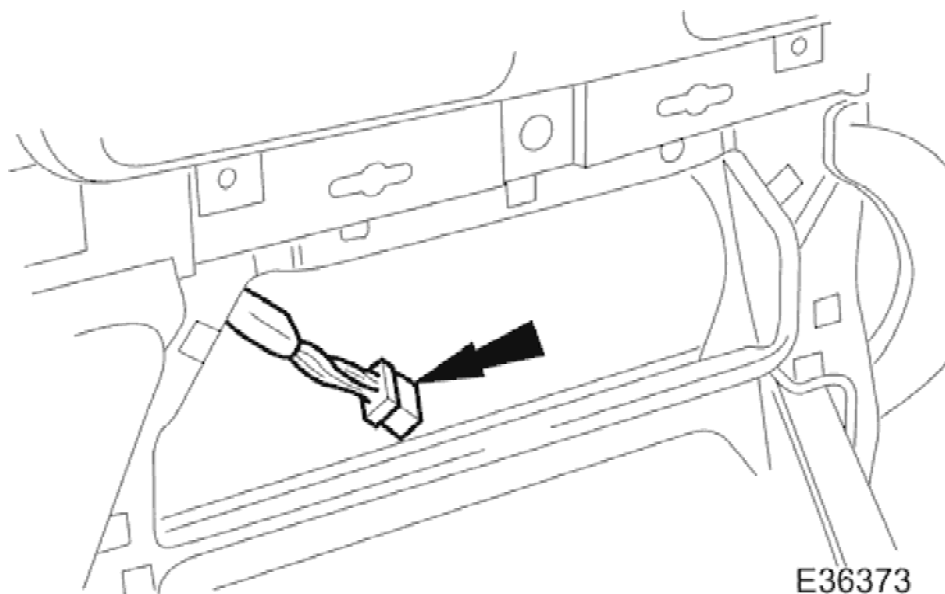

E36373

6. Remove air conditioning switch module / center console switch module assembly.
 - Disconnect center console switch module harness connector.
 - Remove assembly.

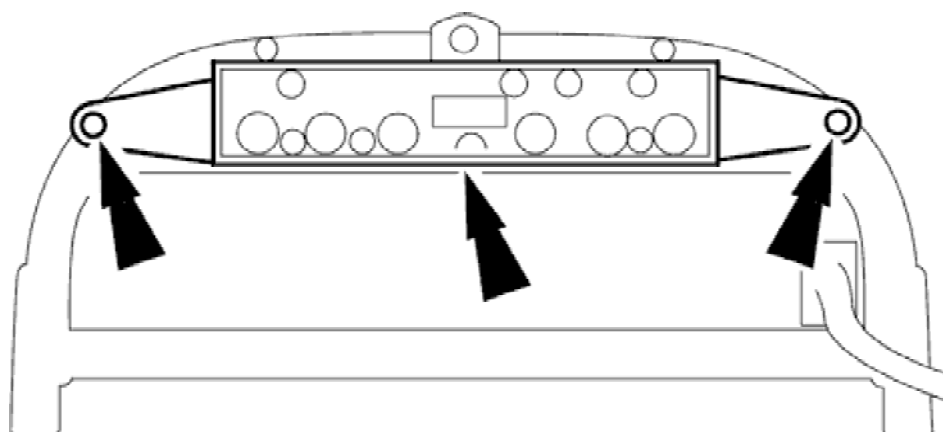

E33374

7. Remove center console switch module.
 - Remove two screws.
 - Remove module.

Installation

1. Installation is reverse of removal.
2. Reconnect battery ground cable; refer to <<86.15.15>>.