XK

DATE 05/01

417-04

SERVICE

TECHNICAL BULLETIN

Cover Becomes Detached From CHMSL –
Revised CHMSL –
Installation Procedure

MODEL 1997-2001 MY XK Convertible VIN 001001-A15347

ISSUE:

Some vehicles may experience a customer complaint of the Center High Mounted Stop Lamp (CHMSL) cover being loosened from the lamp assembly during the drying operation in an automatic car wash.

ACTION:

A revised CHMSL assembly has been introduced (starting with VIN A15347) that has improved retention capability and will prevent the cover becoming detached. In case of a customer complaint on an XK convertible within the above VIN range, install the revised CHMSL.

To replace the CHMSL assembly, follow the Workshop Procedure below:

Note: The CHMSL cover is supplied in a primed finish. Make sure it is been painted to the correct vehicle specification before installation.

WORKSHOP PROCEDURE

- 1. Open luggage compartment lid.
- 2. Remove the fasteners located on the forward edge of the luggage compartment lid liner (Illustration 1).

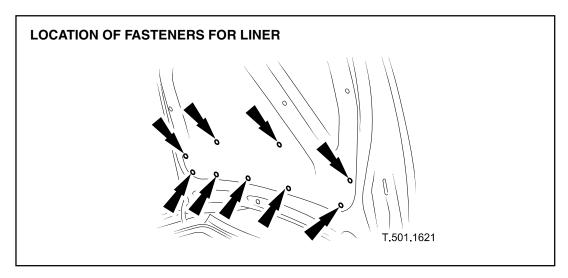


ILLUSTRATION 1



3. Behind the liner, locate and disconnect the connector for the harness from the CHMSL to the luggage compartment harness (Illustration 2).

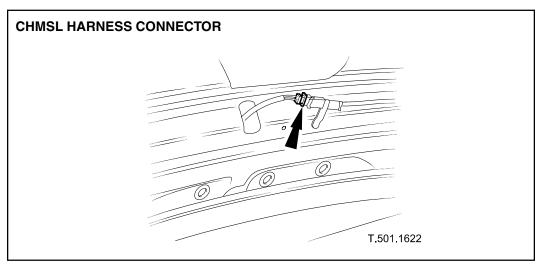


ILLUSTRATION 2

4. Remove the blanking plugs in the forward edge of the luggage compartment lid (Illustration 3).

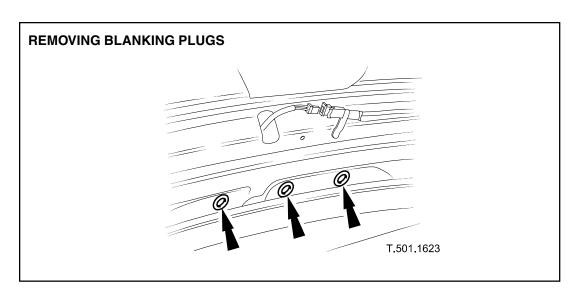


ILLUSTRATION 3

- 5. Remove the nuts securing the CHMSL to the luggage compartment lid (Illustration 4).
- 6. Remove the CHMSL from the luggage compartment lid, routing the harness through the opening.
- 7. Place the CHMSL assembly to one side.
- 8. Align and install the newly painted CHMSL cover on the revised CHMSL.

- 9. Route the CHMSL harness through the opening in the luggage compartment lid.
- 10. Reposition and install the CHMSL on the luggage compartment lid.
- 11. Tighten the nuts securing the CHMSL to the luggage compartment lid.
- 12. Insert and fully seat the blanking plugs.
- 13. Reconnect the CHMSL harness connector.
- 14. Insert and fully seat the securing fasteners for the luggage compartment lid liner.
- 15. Close the luggage compartment.

Parts Information:

DESCRIPTIONPART NUMBERCenter High Mounted Stop LampLJB 5001ADCover - Center High Mounted Stop Lamp (Primed)LJA 5003AB XXX

Warranty Information:

FAULT	R.O.		TIME
CODE	NUMBER	<u>DESCRIPTION</u>	ALLOWANCE
QN DB 07	86. 41.01/70	Center High Mounted Stop Lamp - Renew	0.15 hrs.
	86.41.00	Paint and clear coat	1.00 hrs.
Sundry Value	;		
ZZ Z6 66		Paints and Materials	

Note: Both SROs (if applicable) should be claimed for against a single Warranty Code.

