


Connector: **C2ME14A**

CONNECTOR HOUSING NOT SERVICEABLE

Description: **Integrated control panel**

Location: **Behind center of Instrument panel**

Qualifier:

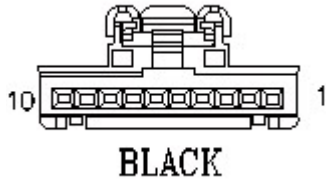


Part No.: **YPC908690**

Colour: **BLACK**

Cavities: **10WY**

Harness: **INSTRUMENT PANEL LHD HARNESS**

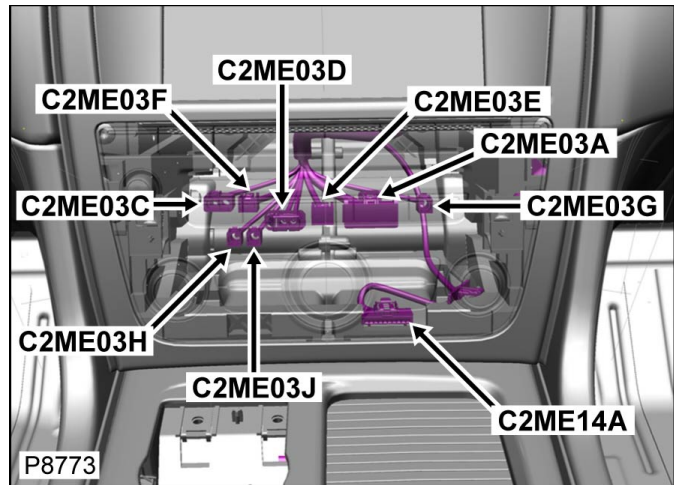

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	GN	ALL	G2D185AR	418-411-45	-	418-116A	418-117	-	418-112	418-107
3	0.5	GY-OG	DR_B	S/JOINT SPL074	418-411-45	-	418-116A	418-117	-	418-112	418-107
4	0.5	VT-OG	DR_B	S/JOINT SPL075	418-411-45	-	418-116A	418-117	-	418-112	418-107
5	0.5	GN-OG	ALL	C32-D	418-411-45	-	418-116A	418-117	-	418-112	418-107
6	0.5	BN-YE	ALL	C32-A	418-411-45	-	418-116A	418-117	-	418-112	418-107
10	0.35	VT-RD	ALL	C32-A	-	-	-	-	-	-	-