



Connector: **C3BP01D**

Description: **Junction box-Central**

**CONNECTOR HOUSING NOT SERVICEABLE**

Location: **Behind rear seat backrest - Left side**

Qualifier:

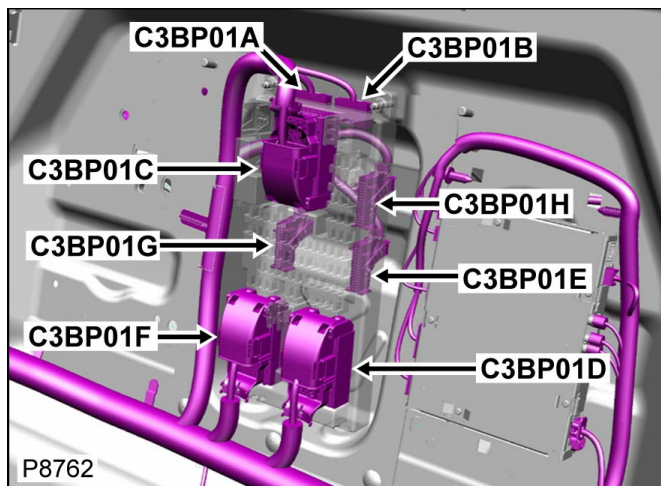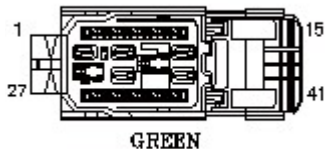

Part No.: **YPC801110**

Colour: **GREEN**

Cavities: **41WY**

Harness: **CABIN LH HARNESS**

**Wire Chart and Service Repair Kit Information**

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
2	1.0	GY-BU	ALL	C31-C	-	-	-	-	-	-	-
4	0.35	BN-GN	JBBBB	C31-D	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
8	0.5	WH-BU	(GTDAD)	C31-D	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
10	0.75	YE	ALL	S/JOINT SPL045	-	-	-	-	-	-	-
11	0.5	VT-GN	ALL	S/JOINT SPL016	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
12	0.5	WH-OG	ALL	S/JOINT SPL012	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
14	0.5	GN-RD	ALL	C4Y122A	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
16	4.0	GN-RD	ALL	C4BF01H	-	-	-	-	-	-	-
19	0.5	BN-YE	JBBBB	C31-E	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
20	4.0	BU-RD	ALL	C4BF01G	-	-	-	-	-	-	-
21	6.0	YE-RD	ALL	C4BF01F	-	-	-	-	-	-	-
22	6.0	RD	ALL	C4BF01E	-	-	-	-	-	-	-
24	0.5	GN-RD	(HNHAB)	C31-E	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
28	0.35	GY-BN	ALL	C31-D	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
29	1.0	BU-GN	ALL	C31-C	-	-	-	-	-	-	-
30	0.35	GY-OG	JBBBB	C31-E	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
31	0.5	GY-VT	(HNHAC)	C31-E	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
32	0.35	BU-GN	ALL	C31-E	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
34	0.35	VT-OG	ALL	C31-C	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
37	0.35	YE-VT	ALL	C31-C	418-411-13	-	418-116A	418-117	418-104	418-112	418-107

38	1.0	BN-BU	ALL	C31-D	-	-	-	-	-	-	-
39	0.35	VT-GY	JBBBB	C31-E	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
40	0.35	YE-OG	JBBBB	C31-E	418-411-13	-	418-116A	418-117	418-104	418-112	418-107